

SB630815

Qced SC

JH

APR 24 2002 NISSAN NORTH AMERICA, INC.  
Copyright ©

# SERVICE BULLETIN

Classification:

BT02-007

Reference:

NTB02-037

Date:

March 28, 2002

## 2002 ALTIMA; BUZZ NOISE AT 2500-2700 RPM, MODERATE LOAD

**APPLIED VEHICLE:** 2002 Altima (L31)

### SERVICE INFORMATION

If a 2002 Altima exhibits all of the following symptoms;

- Buzz noise from the engine compartment area
- Noise occurs during engine speeds from 2500-2700 RPM
- Noise occurs when the engine is under moderate load

The automatic transmission breather tank bracket may be resonating against the left front frame rail, where it is mounted. Use the Service Procedure below to repair the incident if it should occur.

### SERVICE PROCEDURE

1. Verify the incident as described in the Service Information, above.
2. Locate the tank and repair the incident as shown in Figure 1.

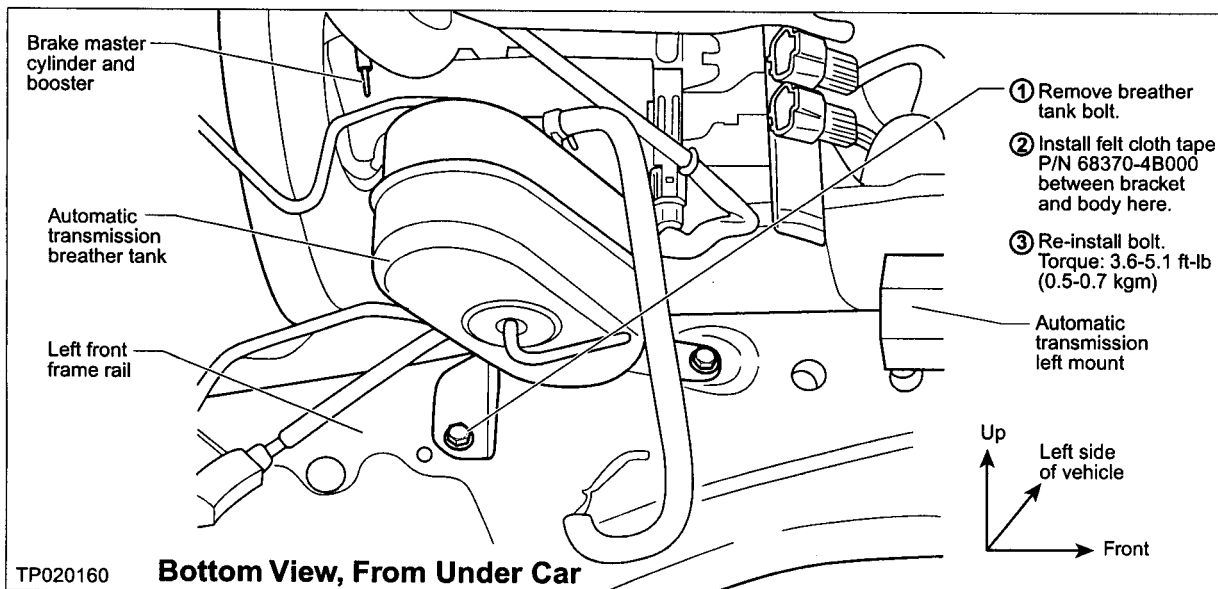


Figure 1

3. Confirm the incident is no longer heard.

#630815

**PARTS INFORMATION**

DESCRIPTION	PART #	QUANTITY
Felt Cloth Tape	68370-4B000*	As needed

\* Available in the Squeak and Rattle Repair Kit (P/N J-43980).

**CLAIMS INFORMATION**

Please reference Nissan Claims Bulletin WB/98-021a and Section "UX - Squeak & Rattle Repairs" of the current Nissan "Warranty Flat Rate Manual" for complete details regarding policy and claims coding applicable to the repair of squeaks and rattles.

**Expense Details:**

Pro-rate the bulk "Squeak & Rattle Repairs" material(s) and claim only the amount that is actually used in the repair. Claim this amount using Expense Code: 022. Do not claim the repair material(s) part number(s) on the claim.

---